

Date: Wednesday, 03/09/2008 10:32:25 AM
 User: Julie Lecocq

Process Sheet

Customer :	CU-DAR001 Dart Helicopters Services	Drawing Name :	AFT TUBE ASSEMBLY
Job Number :	41754		
Estimate Number :	10699		
P.O. Number :		Part Number :	D3391025
This Issue :	03/09/2008	S.O. No. :	
Prsht Rev. :	NC	Drawing Number :	D3391 REV G
First Issue :	//	Project Number :	N/A
Previous Run :	41753	Drawing Revision :	G
	Type :	Material :	
	SKIDTUBES	Due Date :	20/09/2008
Written By :		Qty:	1
Checked & Approved By :	<u>MD08.9.03</u>	Um:	Each
Comment :	Est Rev B 06-02-07 ECN773 dwg rev. D EC Est Rev:C 06-03-28 Update Manuf. Instructions JLM est rev D 07.03.20 revF dwg EC est rev E 07.11.07 rev G dwg ecn 1053p EC verified by: DD Est Rev:F 07-11-13 ECN 1056 DD verified by: EC		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	D6014090	ALUMINUM EXTRUSION
-----	----------	--------------------



Comment: Qty.: 1.0000 f(s)/Unit Total : 1.0000 f(s)

ALUMINUM EXTRUSION

Pick:

Qty	Part Number	Description	Batch
-----	-------------	-------------	-------

1	D6014-090	Extrusion	<u>B32309</u>
---	-----------	-----------	---------------

Identify as D3391-3

a.m - 08.09.10 (6)

2.0	MORI SEIKI	MORI SEIKI CNC LATHE LARGE
-----	------------	----------------------------

**Comment:** MORI SEIKI CNC LATHE LARGETurn as per Folio FA599 Rev: PA & Dwg D3391 Rev: E

a.m 08.09.10 (1)

3.0	QC2	INSPECT PARTS AS THEY COME OFF MACHINE
-----	-----	--

**Comment:** INSPECT PARTS AS THEY COME OFF MACHINE

a.m 08-09-10 (1)

4.0	HAAS1	HAAS CNC VERTICAL MACHINING #1
-----	-------	--------------------------------

**Comment:** HAAS1-Machine as per Folio FA 599 Rev: HA & Dwg D3391 Rev: G

2-Deburr

H.A 08/09/23

08/09/22

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 03/09/2008 10:32:25 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: AFT TUBE ASSEMBLY

Job Number: 41754

Part Number: D3391025

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

QC2

INSPECT PARTS AS THEY COME OFF MACHINE



Comment: INSPECT PARTS AS THEY COME OFF MACHINE

HA 08/09/23

6.0

QC8

SECOND CHECK



Comment: SECOND CHECK

ML 08/09/27

①

7.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Drill (PILOT HOLE) aft cap holes per Dwg D3391 using DT8803

SL 8-10-3

8.0

BENDING

BENDING MACHINE - SKIDTUBES



Comment: NC Bender

Form as per Dwg D3391 Using Bend Prog 3391025

2T 08-10-03

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

DP 8-10-3

10.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open Aft cap pilot hole to .208" as per Dwg D3391

2-Drill float bag holes using DT8809 as per Dwg D3391(Holes marked "A" Only.

3-Drill wearplate holes as per Dwg D3391 using DT8878(Mid Tube) & DT8217 Wearplate Jig .

*****Do Not Open To Finished Size*****

4-Drill Wearshoe holes as per DWG D3391 using DT8939 locating from 2 previously drilled aft wearplate holes.

5-Open wearplate holes to 0.250" and c'bore as per dwg D3391

6-Open up all wearshoe , wearplate to 0.297"and float bag holes to 0.328" as per Dwg D3391.

7-Deburr

Tools: rill

SL 8-11-1

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 03/09/2008 10:32:25 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: AFT TUBE ASSEMBLY

Job Number: 41754

Part Number: D3391025

Job Number:



Seq. #:

Machine Or Operation:

Description :

11.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

06-11-03

12.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Acid etch and Alodine as per QSI 005 4.1

AWM 8-11-04

13.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

am 08-11-04

14.0

D36704200

SPACER



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

SPACER

batch: 41863

(4)

SL 8-11-14

15.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

Instal spacers as per dwg D3391

A/R Magnabond 6398 Batch: 050966

exp. date: 9-10-1

cure time 12hrs as per QSI0015

SL 8-11-16

16.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 08/11/17

17.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

START TIME:

OVEN TEMPERATURE:

FINISH TIME:

11:40
320 °C
12:10

M-1

08/11/20

(IX)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 03/09/2008 10:32:25 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: AFT TUBE ASSEMBLY

Job Number: 41754

Part Number: D3391025

Job Number:



Seq. #:

Machine Or Operation:

Description :

18.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

09-02-26 (X)

19.0

D2646

Aft Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Aft Cap

Pick:

Qty Part Number Description Batch
1 D2646 Aft Cap

B43801

M-h

20.0

D35371

Wearpad



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARPAD

B44815

M-h

21.0

D35377

Wearpad



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Wearpad

B33869

M-h

22.0

D35531

Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Gasket

B31630

M-h

23.0

D35533

Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Gasket

B33870

M-h

24.0

D36721

Phenolic Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

PHENOLIC WASHER

B39275

M-h

25.0

ALS41032130

Insert



Comment: Qty.: 14.0000 Each(s)/Unit Total : 14.0000 Each(s)

INSERT

batch:

M1108606

M-h

09/02/27

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 03/09/2008 10:32:25 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: AFT TUBE ASSEMBLY

Job Number: 41754

Part Number: D3391025

Job Number:



Seq. #:

Machine Or Operation:

Description :

or equivalent per
QSI 017

26.0

ALS41032225

Insert



Comment: Qty.: 12.0000 Each(s)/Unit Total : 12.0000 Each(s)

INSERT

or equivalent
Per QSI 017

M109817

M-L

27.0

AN3C4A

BOLT



Comment: Qty.: 6.0000 Each(s)/Unit Total : 6.0000 Each(s)

Bolt

Pick:

Qty	Part Number	Description	Batch
2	AN3C4A	Bolt	

M110844

M-L

28.0

AN3C5A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Bolt

M110916

M-L

29.0

AN960C10L

washer



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

Inventory

Pick:

Qty	Part Number	Description	Batch
2	AN960C10L	Washer	

M110267

M-L

30.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: SMALL & MEDIUM FAB RESOURCE 1

1-Install inserts as per Dwg D3391

2-Install Aft Cap as per Dwg D3391

A/R Sikaflex-241/-291

Sikaflex expiry date:

M109883
09/11

M-L 09/02/27

(IX)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 03/09/2008 10:32:25 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: AFT TUBE ASSEMBLY

Job Number: 41754

Part Number: D3391025

Job Number:



Seq. #:

Machine Or Operation:

Description :

31.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

09/03/03 (X)

32.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and Stock

Location:

45975

9/3/03

(X)

50

33.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

09/03/13

Job Completion



09-03-13


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

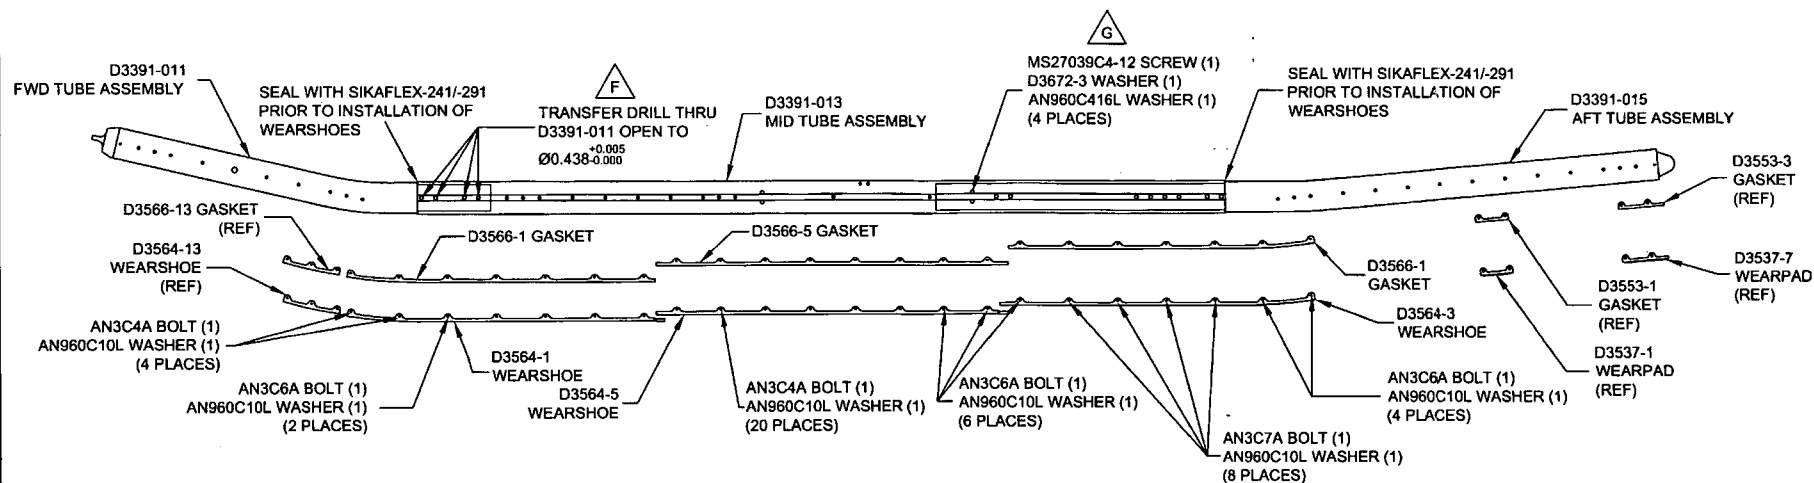

RELEASED
07-11-06

D3391-041 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

QTY	PART NUMBER	DESCRIPTION
1	D3391-041	FLOAT SKIDTUBE ASSEMBLY
1	D3391-011	FWD TUBE ASSEMBLY
1	D3391-013	MID TUBE ASSEMBLY
1	D3391-015	AFT TUBE ASSEMBLY
1	D3564-1	WEARSHOE
1	D3564-3	WEARSHOE
1	D3564-5	WEARSHOE
2	D3566-1	GASKET
1	D3566-5	GASKET
4	D3672-3	WASHER
24	AN3C4A	BOLT
12	AN3C6A	BOLT
8	AN3C7A	BOLT
44	AN960C10L	WASHER
4	MS27039C4-12	SCREW
4	AN960C416L	WASHER

GENERAL NOTES

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH
AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH
LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS
OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES
FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT
WHERE INDICATED.

G	REPLACE NAS INSERTS W/ AELS INSERTS SWITCH TO D3670-XXXX SPACERS FOR INSTALLING FLOAT BAGS, DWG REORGANIZED FOR CLARITY	DC	07.07.31
F	ADD SS WEARSHOE, GASKET REMOVE FWJ SADDLE HOLE -011/-021	PH	07.01.18
E	CHANGE TOLERANCE, EASE MANUFACTURE	PH	06.04.25
D	UPDATE TOLERANCE, CHANGE HOLE SIZE	PH	06.01.23
C	LENGTHEN AFT EXTENSION	PH	05.09.27
B	DRAWING UPDATES	PH	05.06.10
A	NEW ISSUE	PH	05.02.07

REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	07.07.31		


DART AEROSPACE USA, INC
PORT HADLOCK, WA

DRAWING NO. D3391
REV. G
SHEET 1 OF 8

TITLE 412 FLOAT SKIDTUBE
SCALE NTS

COPYRIGHT © 2003 BY DART AEROSPACE USA, INC
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE USA, INC

NO. 11754
WORK ORDER
WITHOUT NOTICE
SUBJECT TO AMENDMENT
CONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY

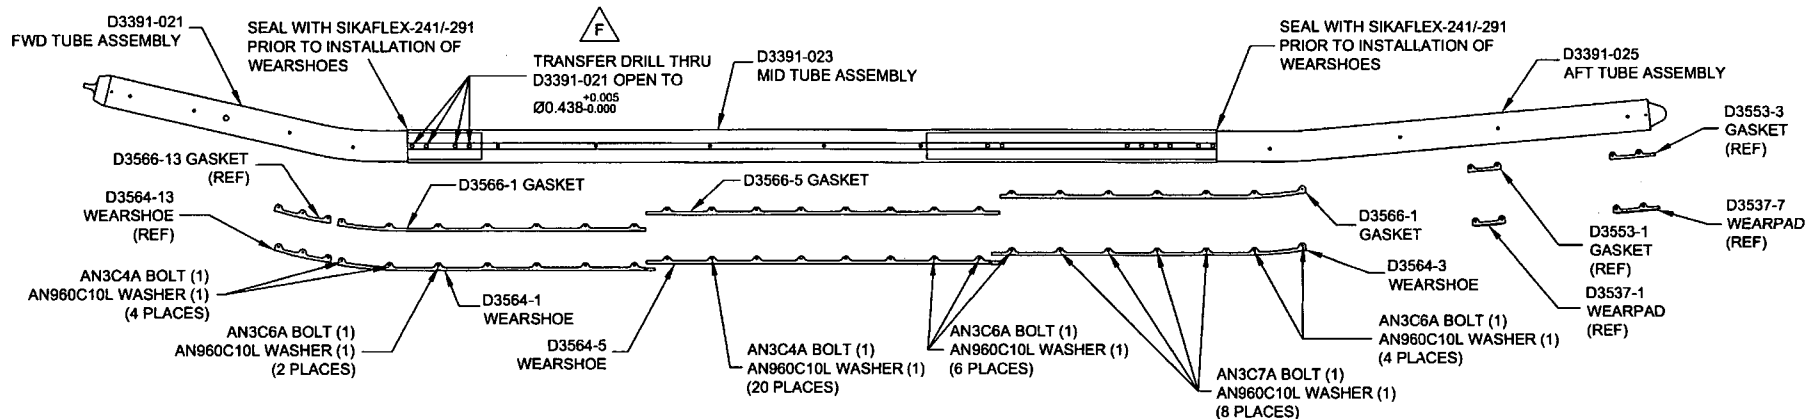

D3391-043 ASSEMBLY

RELEASED
07.11.94

D3391-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST


QTY	PART NUMBER	DESCRIPTION
X	D3391-043	FLOAT SKIDTUBE ASSEMBLY
1	D3391-021	FWD TUBE ASSEMBLY
1	D3391-023	MID TUBE ASSEMBLY
1	D3391-025	AFT TUBE ASSEMBLY
1	D3564-1	WEARSHOE
1	D3564-3	WEARSHOE
1	D3564-5	WEARSHOE
2	D3566-1	GASKET
1	D3566-5	GASKET
24	AN3C4A	BOLT
12	AN3C6A	BOLT
8	AN3C7A	BOLT
44	AN960C10L	WASHER

GENERAL NOTES


- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY. CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT WHERE INDICATED.

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	JLC	PORT HADLOCK, WA	
CHECKED	J	DRAWING NO.	REV. G
MFG. APPR.	JP	D3391	SHEET 2 OF 8
APPROVED	PH	TITLE	SCALE
DE APPR.	PH	412 FLOAT SKIDTUBE	NTS
DATE	07.07.31	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL. AND IS SUPPLIED ON THE UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	


SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 41754

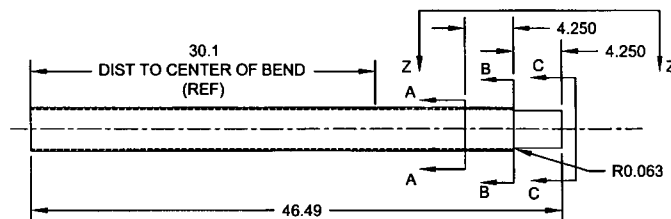


D3391-1 CUTTING DETAIL
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

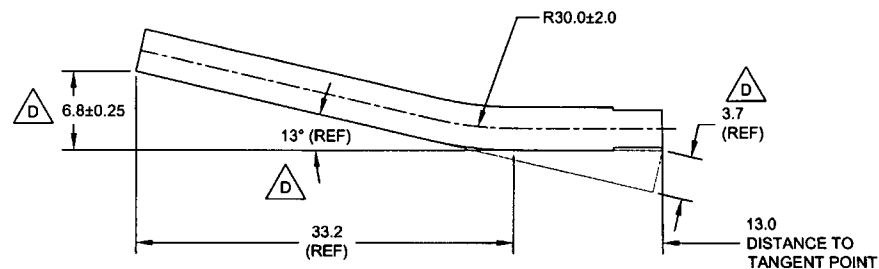


D3391-011/-021 BENDING DETAIL
(MAKE FROM D3391-1)

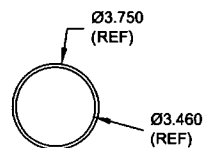


SECTION A-A
(SCALE 1:5)

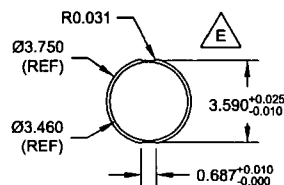

SECTION B-B
(SCALE 1:5)

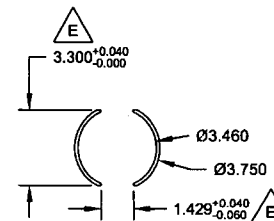

SECTION C-C
(SCALE 1:5)

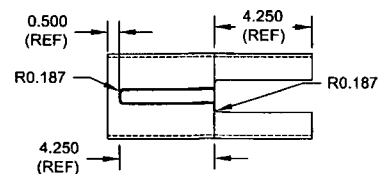












VIEW Z-Z
(SCALE 1:5)

RELEASED
07-11-06 11P

NO. 47554
WORK ORDER
SUBJECT TO AMENDMENT
WITHOUT NOTICE
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY

DESIGN		DART AEROSPACE USA, INC	
DRAWN		PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. G
MFG. APPR.		D3391	SHEET 3 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	1:10
DATE	07.07.31	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

8 7 6 5 4 3 2 1

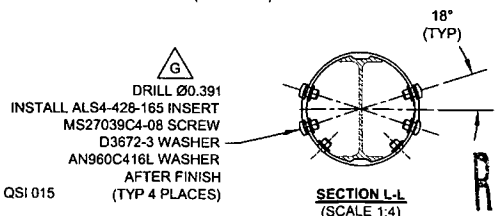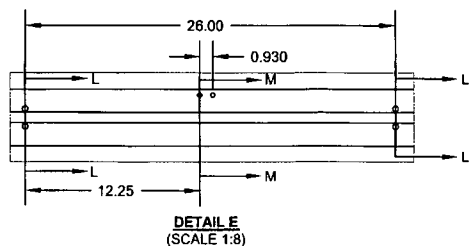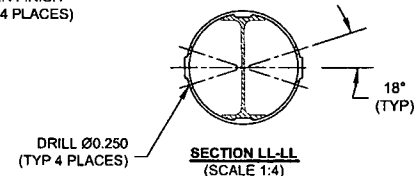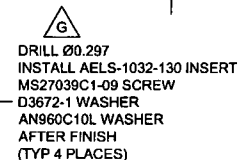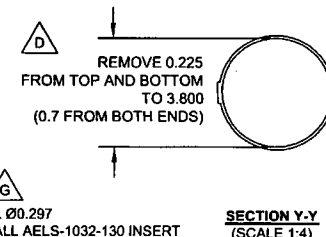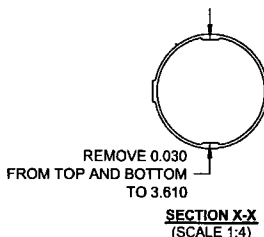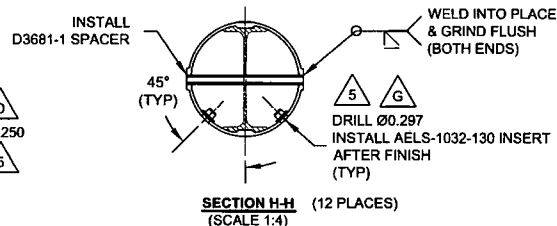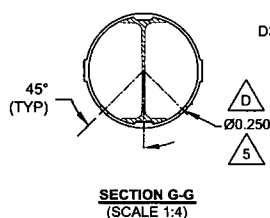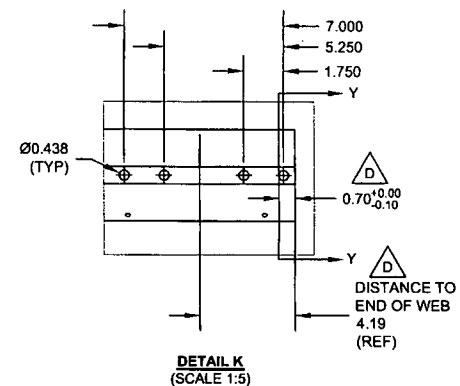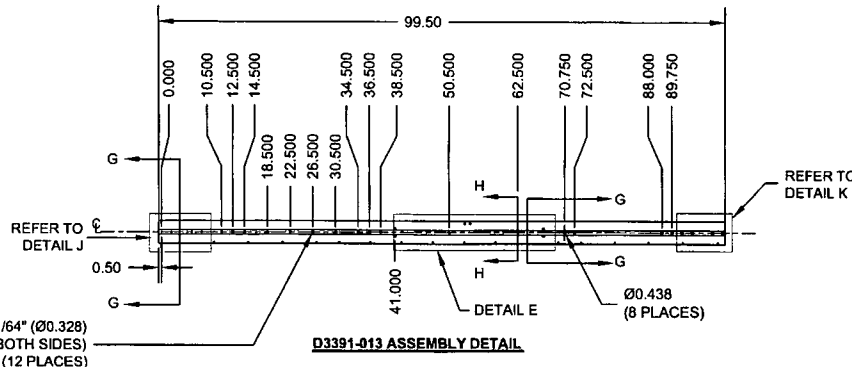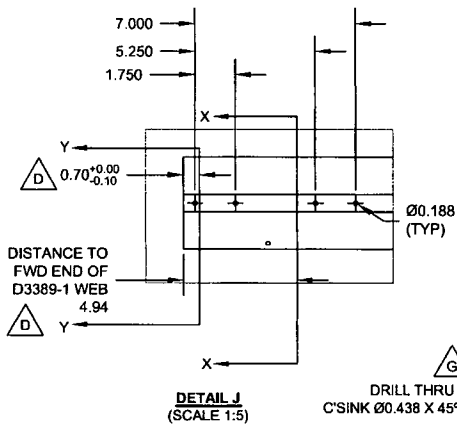

D3391-013 MID TUBE ASSEMBLY PARTS LIST

QTY -013	PART NUMBER	DESCRIPTION
X	D3391-013	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
12	D3681-1	SPACER
4	D3672-1	WASHER
4	D3672-3	WASHER
24	AELS-1032-130	INSERT
4	ALS4-426-165	INSERT
4	AN960C10L	WASHER
4	AN960C416L	WASHER
4	MS27039C1-09	SCREW
4	MS27039C4-08	SCREW






D3391-013 MID TUBE ASSEMBLY

- MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/291 PER QSI 015
- WELDING WORK ORDER

RELEASED

DESIGN	PH	DART AEROSPACE USA, INC
DRAWN	DE	PORT HADLOCK, WA
CHECKED	DE	DRAWING NO. D3391
MFG. APPR.	DE	REV. G SHEET 5 OF 8
APPROVED	DE	TITLE 412 FLOAT SKIDTUBE
DE APPR.	DE	SCALE 1:20
DATE	07.07.31	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC

SHOP COPY
RETURN TO
ENGINEERING
CONTROLLED COPY
FOR AMENDMENT
WITHOUT NOTICE
WORK ORDER
41754

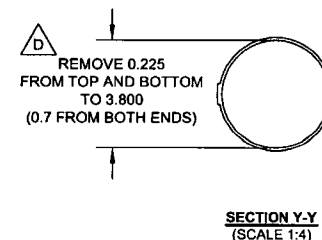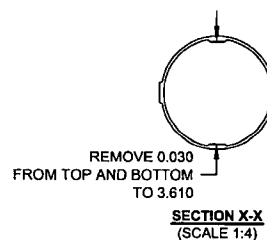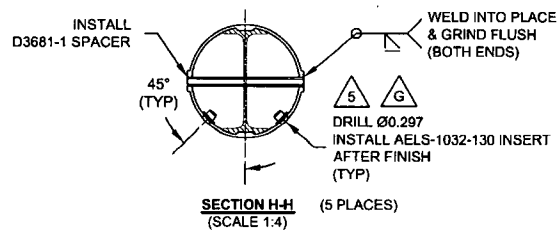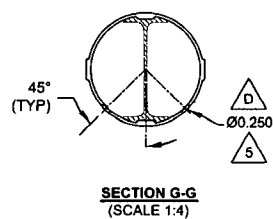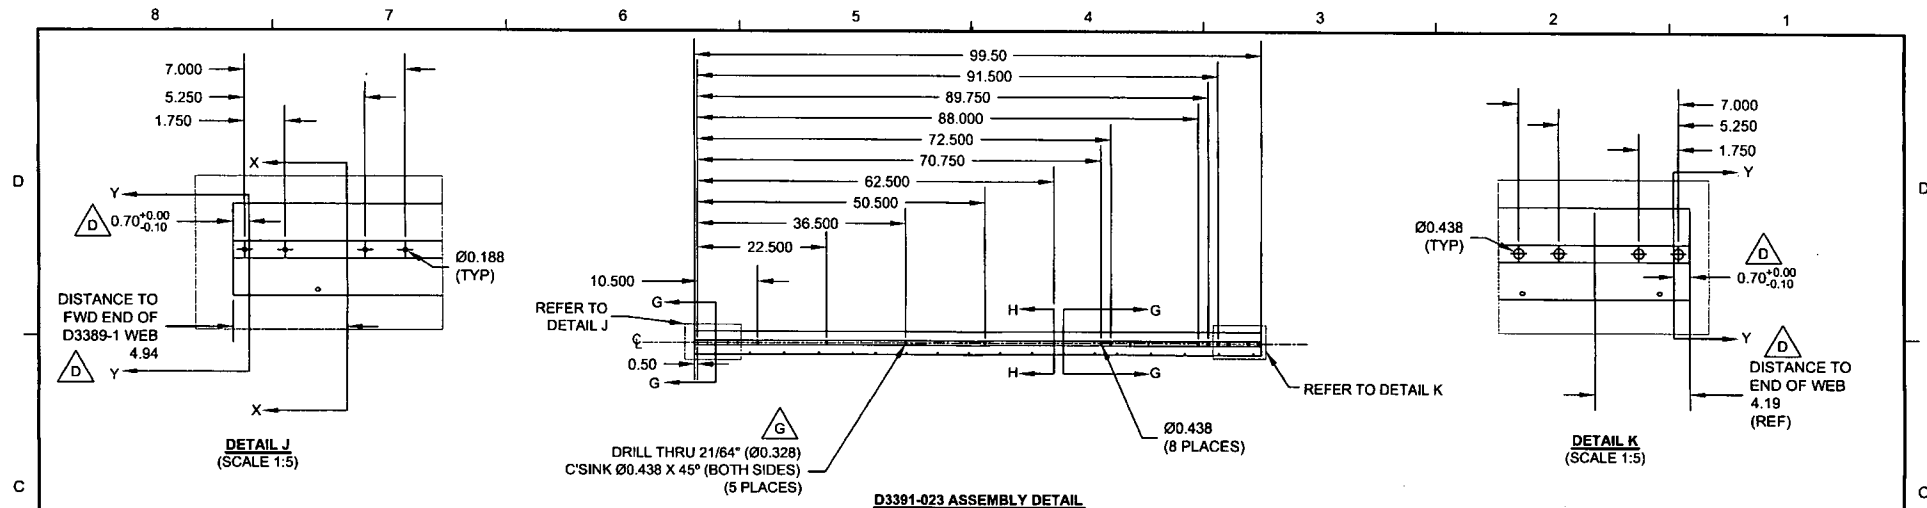

D3391-023 MID TUBE ASSEMBLY PARTS LIST

QTY - 023	PART NUMBER	DESCRIPTION
X	D3391-023	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
5	D3681-1	SPACER
20	AELS-1032-130	INSERT


D3391-023 MID TUBE ASSEMBLY

- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/-291 PER QSI 015
- 3) WELDING PER DART QSI 015

RELEASED
07.11.06/11


DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	DE	PORT HADLOCK, WA	
CHECKED	DE	DRAWING NO.	REV. G
MFG. APPR.	DE	D3391	SHEET 6 OF 8
APPROVED	DE	TITLE	SCALE
DE APPR.	DE	412 FLOAT SKIDTUBE	1:20
DATE	07.07.31	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

SHOP COPY
RETURN TO
ENGINEERING
CONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
41784

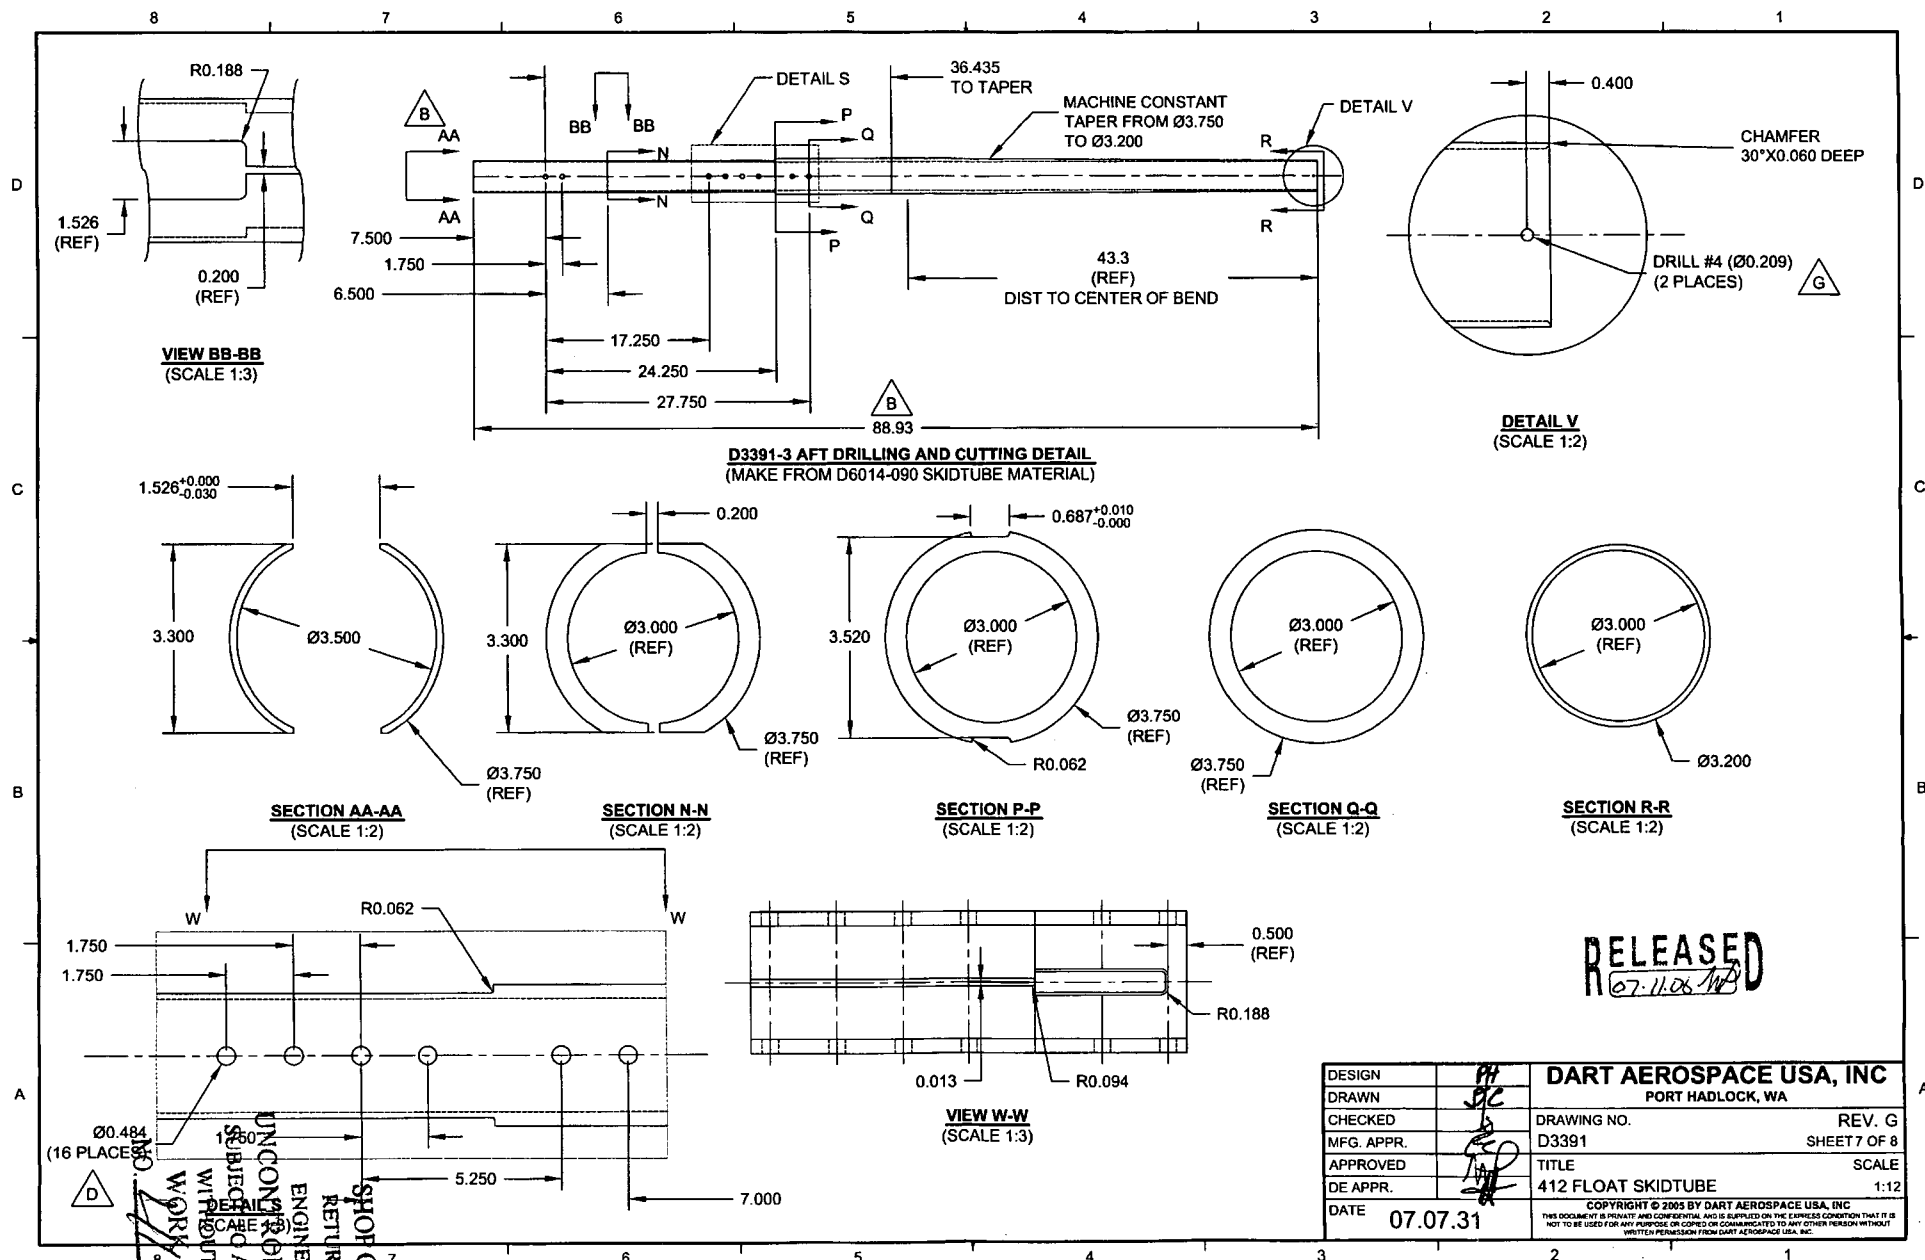


RELEASED
07-11-06

UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
11/13/34

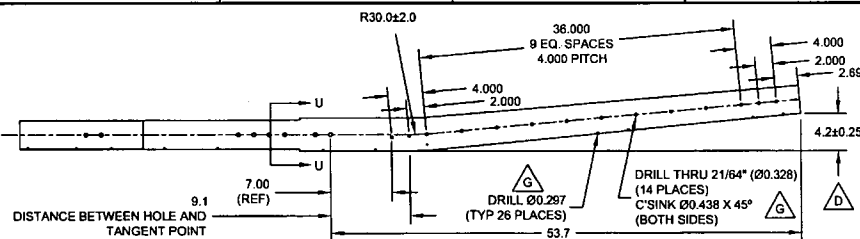


D3391-015 BENDING AND DRILLING DETAIL
(SEE C'BORE DETAIL BELOW)

INSTALL D3670-4200 SPACER
SEAL WITH MAGNOBOND 6398
GRIND FLUSH
PRIOR TO PAINTING
(14 PLACES)

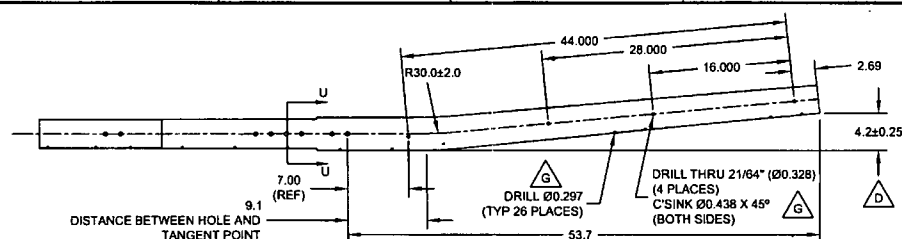


D3391-025 BENDING AND DRILLING DETAIL
(SEE C'BORE DETAIL BELOW)

INSTALL D3670-4200 SPACER
SEAL WITH MAGNOBOND 6398
GRIND FLUSH
PRIOR TO PAINTING
(4 PLACES)

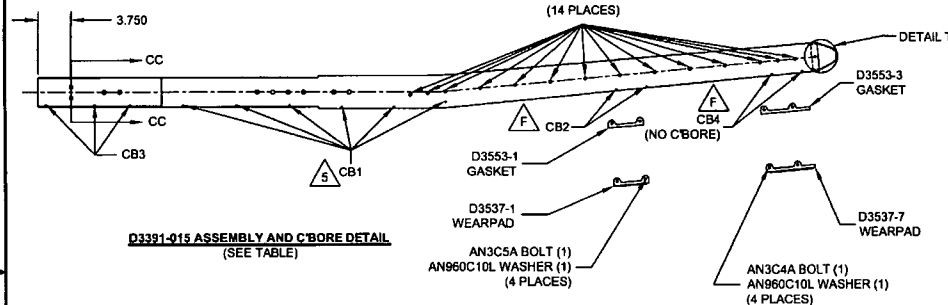


D3391-015 ASSEMBLY AND C'BORE DETAIL
(SEE TABLE)

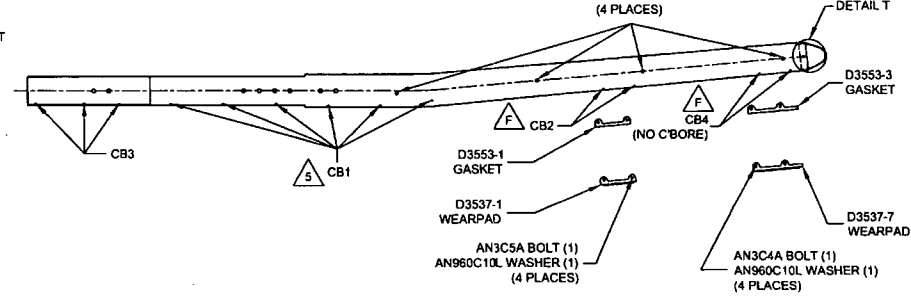


D3391-025 ASSEMBLY AND C'BORE DETAIL
(SEE TABLE)

D3391-015/025 AFT TUBE ASSEMBLY PARTS LIST

QTY - 015	QTY - 025	PART NUMBER	DESCRIPTION
X	X	D3391-015	AFT TUBE ASSEMBLY
		D3391-025	AFT TUBE ASSEMBLY
1	1	D6014-090	AFT TUBE
1	1	D2646	AFT CAP
1	1	D3537-1	WEARPAD
1	1	D3537-7	WEARPAD
1	1	D3553-1	GASKET
1	1	D3553-3	GASKET
14	4	D3670-4200	SPACER
2	2	D3672-1	WASHER
14	14	AELS-1032-130	INSERT
12	12	AELS-1032-225	INSERT
4		ALS4-428-165	INSERT
6	6	AN3C4A	BOLT
4	4	AN3C5A	BOLT
10	10	AN960C10L	WASHER

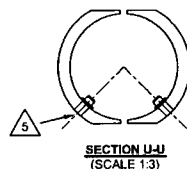


SECTION U-U
(SCALE 1:3)

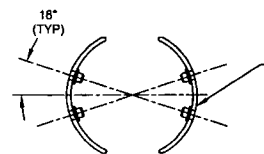

SECTION CC-CC
(SCALE 1:3)

DRILL Ø0.381
C'BORE Ø0.516 X 0.040 DEEP
INSTALL ALS4-428-165 INSERT (1)
(4 PLACES)

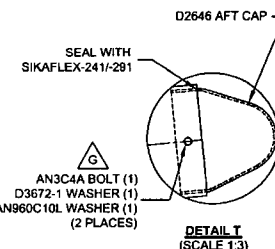

DETAIL T
(SCALE 1:3)

RELEASED
07.11.06

C'BORE HOLES MARKED CB1-CB4 AS FOLLOWS AND
INSTALL AELS-1032-XXX AFTER FINISH AS NOTED

HOLES MARKED	QTY D3391-015	QTY D3391-025	C'BORE	P/N
CB1	12	12	Ø0.430 X 0.170	AELS-1032-225
CB2	4	4	Ø0.430 X 0.170	AELS-1032-130
CB3	4	4	Ø0.430 X 0.040	AELS-1032-130
CB4	NO	NO	NONE	AELS-1032-130

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
21784

DESIGN	HH	DART AEROSPACE USA, INC
DRAWN	DK	PORT HADLOCK, WA
CHECKED	JS	DRAWING NO. REV. G
MFG. APPR.	JP	D3391 SHEET 8 OF 8
APPROVED	JP	TITLE SCALE
DE APPR.	JP	412 FLOAT SKIDTUBE 1:12
DATE	07.07.31	COPYRIGHT © 2003 BY DART AEROSPACE USA, INC

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DART AEROSPACE LTD		Work Order: B41254
Description: Float Skidtube (412)		Part Number: D3391-3
Inspection Dwg: D3391	Rev: G	Page 1 of 1

FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article ☐ Prototype

Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
14.000	+/-0.010	14.000	/			
3.500	+/-0.010	3.491	/			
88.93	+/-0.030	88.930	/			
44.995	+/-0.030	44.995	/			
3.200	+/-0.010	3.200	/			
1.526	+0.000/-0.030	1.510	/			
0.200	+/-0.010	.200	✓			
7.500	+/-0.010	7.502	✓			
27.750	+/-0.010	27.750	✓			
31.750	+/-0.010	31.750	✓			
35.250	+/-0.010	35.250	✓			
3.300	+/-0.010	3.300	✓			
0.200	+/-0.010	.200	✓			
3.520	+/-0.010	3.520	✓			
0.687	+0.010/-0.000	.693	✓			
R0.062	+/-0.010	R0.062	✓			
Ø0.484	+0.005/-0.001	Ø0.488	✓			

Measured by: G.m/H.A 08/09/23	Audited by: ml	Prototype Approval:	N/A
Date: 08.09.10	Date: 08/09/27	Date:	N/A

Rev	Date	Change	Revised by	Approved
A	06.04.24	New Issue P/O D3391-015/-025	KJ/JLM	
B	06.06.19	Dwg revision update	KJ/JLM	
C	07.04.20	Ø0.208 dimension removed	KJ/JLM	
D	07.09.06	0.400 dimension removed	KJ/JLM	
E	07.11.23	Dwg Rev. updated	KJ/EC/DD	